Detail 1/F7

Note: See 11/F8 & 12/F8 for truss seat details on trusses 3 & 5

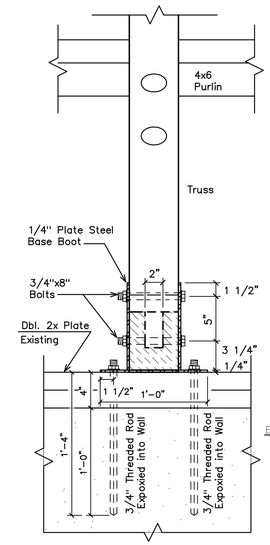

End View

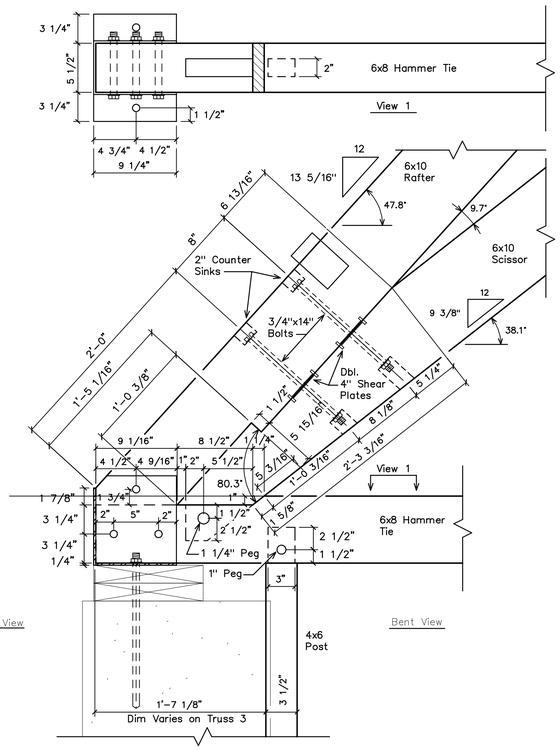

Bent View

Detail 2/F7

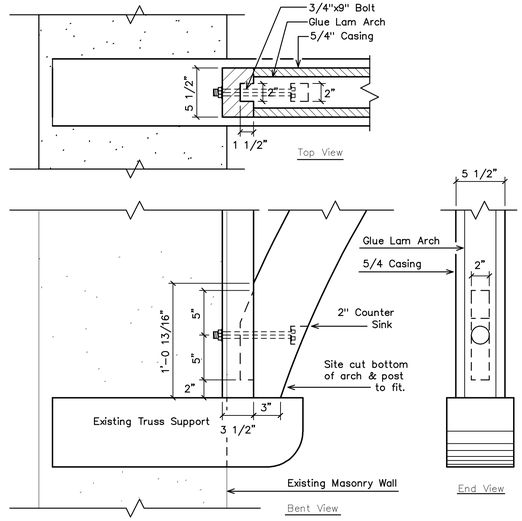

Detail 3/F7

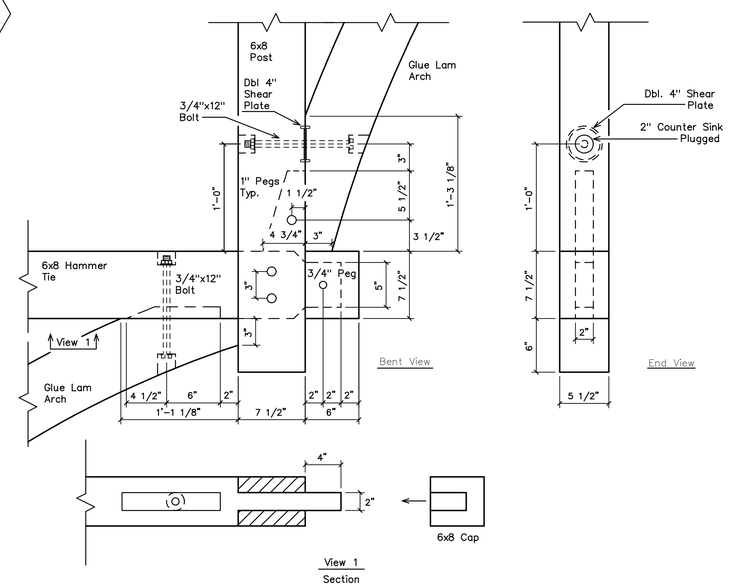

Detail 4/F7

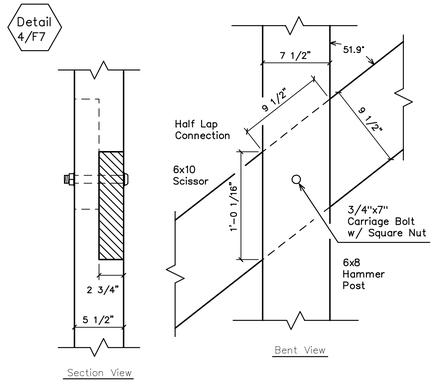

Section View

Bent View

Detail 5/F7

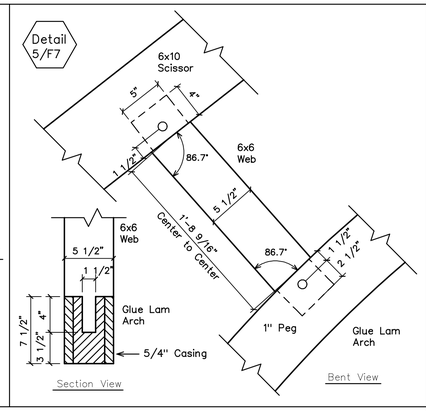

Section View

Bent View

Detail 6/F7

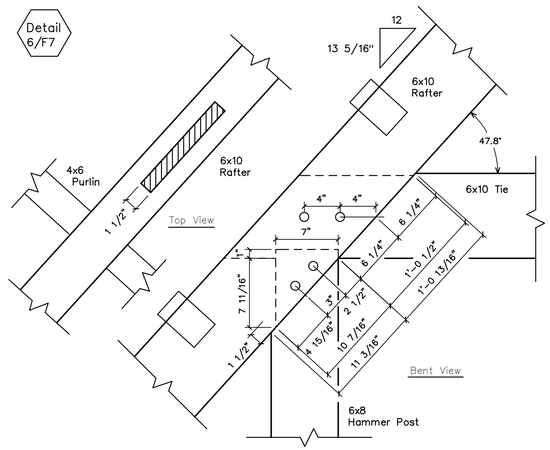

Top View

Bent View

Detail 7/F7

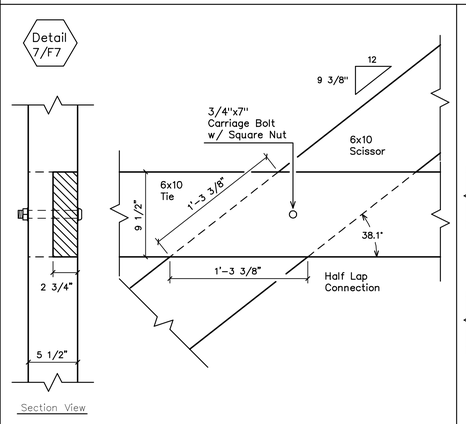

Section View

Detail 8/F7

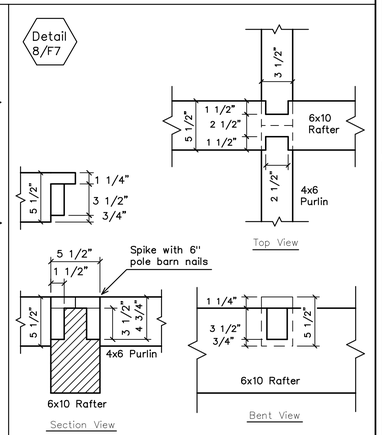

Detail 9/F7

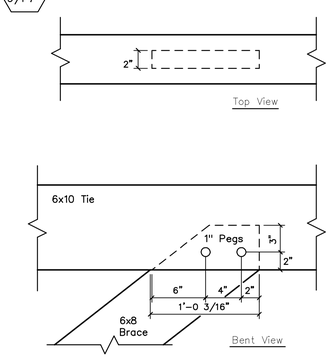

Bent View

Detail 10/F7

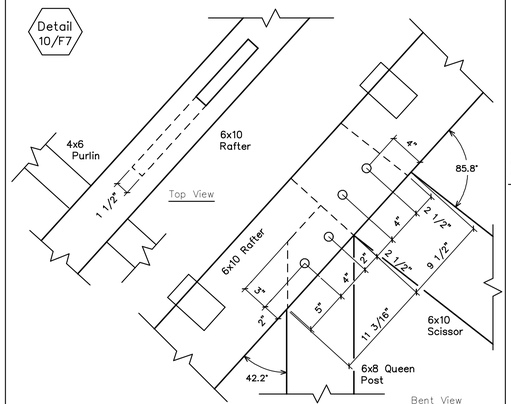

Bent View

Detail 11/F7

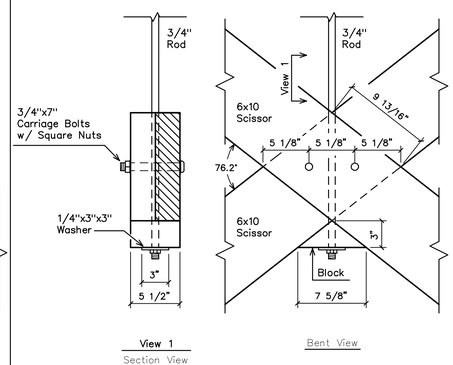

Detail 12/F7

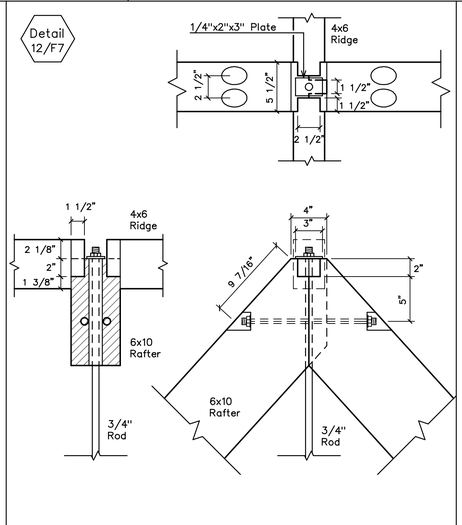

Detail 13/F7

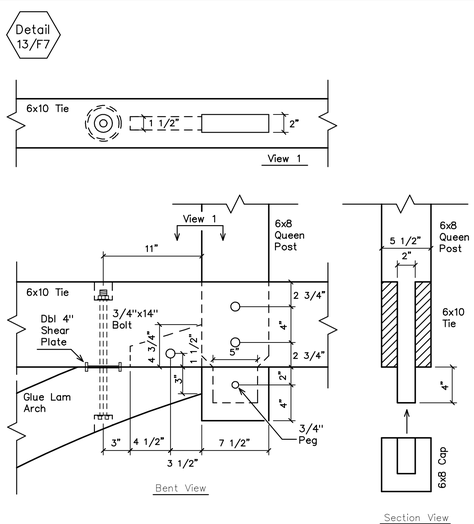

REVISIONS	BY
6/10/02	
6/17/02	
6/24/02	

VERMONT TIMBER WORKS
SPRINGFIELD VERMONT
802-885-1917

SHOP DRAWINGS

Joint Details

PROJECT: First Presbyterian Church
Navasota, Texas
Timber Restoration

DRAWN : D.F.	CHECKED :
DATE : 6/4/02	
SCALE : 1 1/2"=1'-0"	
JOB NO. :	
SHEET F—7	
OF SHEETS	